


April 2026

Installation Instructions

902055-02-3: PIM Shield
 Polymer Cable Support Bar,
 Polymer Pole Mount Kit, 26
 Position, Extended Range, 3
 Pack


STEP 1

Attach threaded rods to clamp brackets, and clamp to pole. Set to correct offset length. Ensure that threaded rods protrude a MINIMUM of 2" past clamp bracket nuts
Torque bracket nuts to 4Ft-lb.

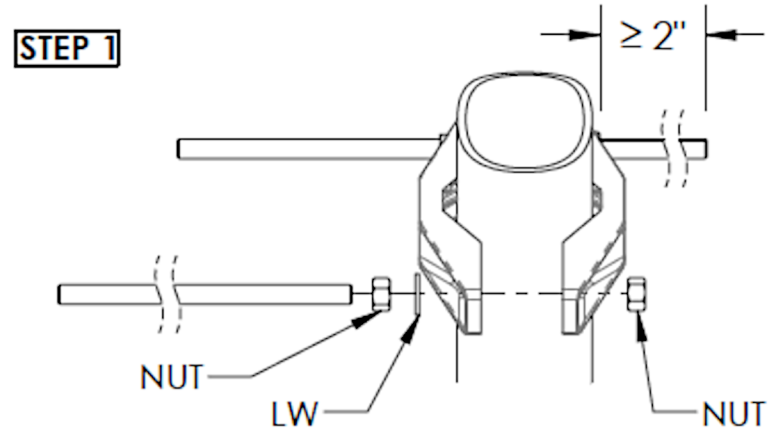


STEP 2

Fasten jam nuts against the nuts at all four corners of the pole clamps. (Using two wrenches, hold the bracket nuts still and tighten the jam nuts into them.)

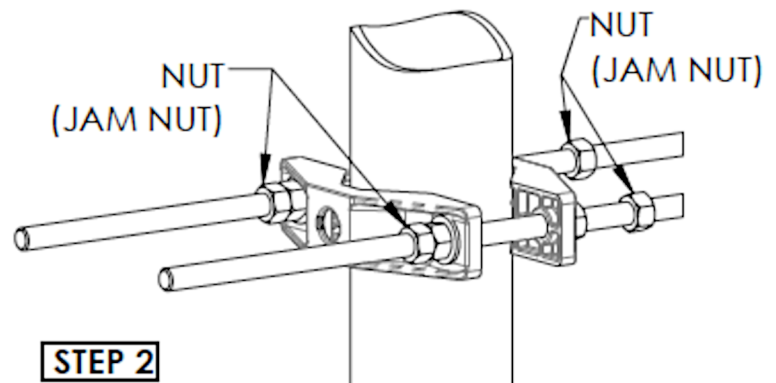

STEP 3

Attach 13 Position Bar to threaded rods.
Torque support bar nuts to 20Ft-lb.

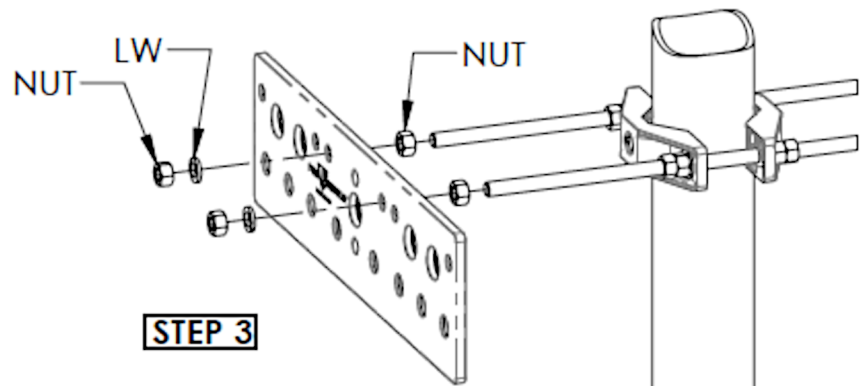

STEP 4

Attach second 13 Position Bar to threaded rods.
Torque support bar nuts to 20Ft-lb.

